

ENGINEERING CHANGE NOTIFICATION FORM

ECN: 80200540

REV: 1

ISSUE DATE: 11/25/2015

TYPE OF CHANGE: Firmware Modification

DETAILED DESCRIPTION OF CHANGE:

Firmware release 1.1 for the M12M Replacement Receiver includes functionality improvements in the SCPI output and bug fixes to correct the LED display malfunctioning during continuous operation.

REASON FOR CHANGE:

Functionality improvements and bug fixes.

PRODUCTS AFFECTED:

Firmware Version	Model	
Firmware 1.0	M12M Replacement Receiver	

AVAILABILITY:

MILESTONE	DATE
ECN release for firmware release files	11/25/2015

Release 1.1 for the M12M Replacement Receiver provides the following improvements:

Issue 1:

The M12M Replacement Receiver did not support the SYNC:TINT? query so GPSCon software would not output phase data when monitoring the M12M status.

Resolution:

Firmware 1.1 fixes this issue by adding the SYNC:TINT? command and equivalent PTIM:TINT? command to output the 1PPS sawtooth correction error.

Issue 2:

The LED display will malfunction after several weeks of continuous operation. Despite the display malfunction, the unit otherwise operates normally.

Resolution:

Firmware 1.1 fixes the issue by correcting the condition that resulted in the display malfunction. **REFERENCE DOCUMENTS/ATTACHMENTS**:

CONTACTS	NAME	EMAIL
Software Engineer	Keith Loiselle	keith@jackson-labs.com

PLEASE CONTACT JACKSON LABS TECHNOLOGIES, INC. WITH ANY QUESTIONS

1635 Village Center Circle, Suite 150, NV 89134 · USA · Phone: +1 (702) 233-1334 - Fax: +1 (702) 233-1073 · info@jackson-labs.com

Copyright© 2015 Jackson Labs. All rights reserved. Last updated: 11/25/2015