

## ENGINEERING CHANGE NOTIFICATION FORM

ECN: 80200576	REV: 1	ISSUE DATE: 4/19/2019
TYPE OF CHANGE: Firmware Modif	ication	
DETAILED DESCRIPTION OF CHANG Firmware release 2.49 for GPS-500 for bu		n uBlox receiver compatibility.
REASON FOR CHANGE:		
Bug fixes and functionality improvem <b>PRODUCTS AFFECTED:</b>	ents.	
Firmware Version	GPS-500	Model
Firmware 2.45 and previous Notes:	61 3-300	
AVAILABILITY:		
MIL	ESTONE	DATE
ECN release for firmware release file	es	4/19/2019
Firmware 2.49 also fixes the NMEA pars	ting and ensuring no NULL value is all	owed in all NMEA outputs before printing. king for valid UTC time and status fields.
Issue 2: The internal clock of GPS-500 will not up SYNC:OUT:1PPS:RESET? command is		S fix and UTC time is available if
Resolution:		
Firmware 2.49 fixes this issue. Units with issue.	h SYNC:OUT:1PPS:RESET ON comm	and configured are not affected by this
DEEEDENICE DOCUMENTS (ATTACUM	ENTS:	
REFERENCE DOCUMENTS/ATTACHM		
CONTACTS	NAME	EMAIL

## PLEASE CONTACT JACKSON LABS TECHNOLOGIES, INC. WITH ANY QUESTIONS

10191 West Park Run Drive, Suite 100, NV 89145 · USA · Phone: +1 (702) 233-1334 - Fax: +1 (702) 233-1073 · info@jackson-labs.com

Copyright @ 2005/2019 Jackson Labs. All rights reserved. Last updated: 4/19/2019